



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123

Case Vehicle (A): 1999 Ford
 Type: Ranger XL 4 x 4, 2-door pickup
 Driver: 27-year-old male
 CDC: 12-FYEW-2

SITUATION

(Slide 1) It was daytime, the sky was clear, and the roads were dry when case vehicle (A) was traveling north at an unknown speed on a two-lane asphalt road. (Slide 2) Case vehicle (A) made a right turn onto a two-lane gravel road, but was traveling too fast for the road surface conditions. (Slide 3) The driver of case vehicle (A) lost control of the vehicle and it exited the south edge of the road surface and (slide 4) struck a 90-cm diameter tree with its left front. The driver and right-front passenger were transported by ambulance to a local hospital and were treated and released. Case vehicle (A) was towed due to damage.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slide 5) Damage to case vehicle (A) was moderate. (Slide 6) Direct damage began at the left bumper corner and extended 57 cm to the right, resulting in 40-percent vehicle overlap. (Slide 7) The maximum crush was 44 cm to the left upper radiator support.

Using the WinSMASH accident-reconstruction program and (slides 8, 9, 10 and 11) a crush profile measured at the front of case vehicle (A), the following impact severity was calculated:

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	37 (23)	-37 (-23)	-0 (-0)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

(Slide 12) Prior to inspection, the front bumper, the hood, the hood latch, and both front fenders were removed from the vehicle by a body shop for repair estimates.

Exterior

In the front, (slides 13 and 14) the left portion of the bumper, the grille, the hood, and the engine compartment were crushed. Both hood hinges were damaged. (Slide 15) The rear edge of the

hood was elevated, but it did not contact the windshield, (slide 16) which was cracked due to occupant contact.

(Slide 17) The left fender was crushed, but there was no significant change in the left wheelbase.

(Slides 18 and 19) The right fender was deformed, but there was no significant change in the right wheelbase.

(Slide 20) There was no damage to the rear of the vehicle.

Interior

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags. (Slide 21) The steering-wheel airbag deployed, (slide 22) but the passenger airbag did not deploy because it was turned off at the switch. (Slides 23, 24, 25, 26 and 27) There was no damage to the flaps/covers of the steering-wheel or passenger airbag modules. (Slides 28 and 29) The upper half of the steering-wheel rim was deformed slightly forward. (Slide 30) There was no damage to the spokes. There was no apparent displacement of the steering column. (Slide 31) The rear-view mirror was cracked and knocked off of its mount. The upper-center portion of the windshield was starred from contact by the rear-view mirror and/or the right-front passenger. (Slide 32) The upper-left portion of the windshield was starred from contact by an interior loose object and/or driver contact. (Slide 33) The glove box area was deformed. (Slide 34) The plastic right lower A-pillar/kickpanel cover was broken and knocked off. (Slide 35) The left-rear jumpseat was knocked loose from its mounts. (Slides 36, 37, 38 and 39) There was no other interior damage and there were no intrusions.

OCCUPANT KINEMATICS AND INJURIES

(Slide 40) The 5-ft, 9-in, 160-lb, 27-year-old male driver was not wearing the three-point belt, (slide 41) but the frontal-impact airbag deployed. (Slides 42) There were no witness marks on the plastic D-ring. The driver seat was in the rear seat-track position.

During the frontal impact, the driver moved forward into the airbag. There was (slide 43) airbag powder on the steering-wheel rim, (slide 44) just above the left or eleven o'clock vent. The driver sustained a first-degree burn to the palmar aspect of the left hand, probably from the hot

airbag gases. He sustained a sprain and contusion to his right knee probably due to contact with the knee bolster, (slides 45 and 46) as evidenced by the scuff marks on the plastic knee bolster cover. (Slide 47) There was a black scuff mark on the right edge of the left knee bolster, and (slide 48) the windshield was starred just to the left of the steering wheel, but no injuries were associated with these witness marks.

(Slide 49) The 5-ft, 9-in, 170-lb, 21-year-old male, right-front passenger was not wearing the three-point belt, and the frontal-impact airbag did not deploy because it was turned off at the switch. (Slides 50) There were no witness marks on the plastic D-ring. The right-front passenger seat was in the full-rear seat-track position.

During the frontal impact, the right-front passenger moved forward into the instrument panel and windshield. He sustained a contusion to the right side of his forehead, probably due to contact with the windshield and/or rear-view mirror, (slides 51 and 52) as evidenced by the starred windshield, skin oil on the windshield, and (slide 53) the cracked rear-view mirror glass. He sustained a contusion to his right knee due to contact with the knee bolster/glove box, (slides 54) as evidenced by an indentation into the plastic knee bolster cover.

The following tables and attached drawings (slides 55 and 56) summarize the injuries sustained by the two occupants of case vehicle (A).

Occupant: Driver
Restraints: 3-point belt not worn; frontal-impact
airbag deployed

Age: 27 years
Stature: 175 cm (5 ft, 9 in)

Gender: Male
Mass: 73 kg (160 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
First degree burn, palmar aspect of the left hand	1		Airbag gas	
Sprain, right knee	2		Knee bolster	
Contusion, right knee	1		Knee bolster	
<u>Maximum A.I.S. Level</u>	<u>2</u>			
<u>Injury Severity Score</u>	<u>5</u>			

Occupant: Right front

Restraints: 3-point belt not worn; frontal-impact airbag did not deploy (turned off at switch)

Age: 21 years

Stature: 175 cm (5 ft, 9 in)

Gender: Male

Mass: 77 kg (170 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Contusion, right side of forehead	1		Windshield/ rear-view mirror	
Contusion, right knee	1		Knee bolster/glove box	
<u>Maximum A.I.S. Level</u>	<u>1</u>			
<u>Injury Severity Score</u>	<u>1</u>			

Duplicate columns 1-8
from the previous card.

Module G 1 Format 0 2
9 10 11 12

GENERAL INFORMATION GI-1

TIME

DATE OF COLLISION

 / /

HOUR OF COLLISION

(24 HOUR CLOCK)

21

24

LOCATION

STATE:

STATE FIPS CODE

AREA

- (1) URBAN
(2) RURAL
(9) UNKNOWN

27

ENVIRONMENTAL CONDITIONS

LIMITED-ACCESS HIGHWAY

- (0) NO
(1) YES
(9) UNKNOWN

28

ROAD, TOTAL TRAFFIC LANES
(FOR CASE VEHICLE)

- (1) 1-LANE
(2) 2-LANES
(3) 3-LANES
(4) 4 OR MORE LANES
(5) DIVIDED, 4 OR MORE LANES
(6) PARKING LOT/DRIVEWAY
(7) OTHER:
(9) UNKNOWN

29

INTERSECTING RD, TOTAL LANES

CHOOSE FROM ABOVE LIST, OR

- (8) NOT APPLICABLE

30

TYPE OF ROAD SURFACE

- (1) ASPHALT
(2) CONCRETE
(3) GRAVEL
(4) MORE THAN ONE (CIRCLE EACH)
(7) OTHER:
(9) UNKNOWN

31

ROAD DEFECTS

- (0) NO
(1) YES
(9) UNKNOWN

32

ENVIRONMENTAL CONDITIONS

CONSTRUCTION ZONE

- (0) NO
(1) YES
(9) UNKNOWN

33

ROAD ALIGNMENT
VERTICAL PLANE

- (1) LEVEL
(2) CREST OF HILL
(3) SLOPE (2%)
(4) BOTTOM OF HILL
(9) UNKNOWN

34

ROAD ALIGNMENT
HORIZONTAL PLANE

- (1) STRAIGHT
(2) CURVE
(3) T - SHAPED
(4) Y - SHAPED
(7) OTHER:
(9) UNKNOWN

35

SURFACE COVERING

- (10) DRY

36 37

- (21) WATER - DAMP
(22) WATER - WET
(23) WATER - PUDDLED
(29) WATER - AMOUNT UNKNOWN

- (31) SNOW - LOOSE
(32) SNOW - PACKED
(39) SNOW - CONDITION UNKNOWN

- (41) ICE
(51) SLUSH
(61) SPILLED GRAVEL
(71) OTHER:
(99) UNKNOWN

VISIBILITY LIMITATION
(FOR CASE VEHICLE)

- (0) NONE
(1) CLOUDY/DARK
(2) FOG
(3) SMOKE
(4) WINDSHIELD CONDITION
(5) GLARE
(6) RAIN
(7) OTHER:
(8) ICE/SNOW
(9) UNKNOWN

38

VISIBILITY OBSTRUCTION
(FOR CASE VEHICLE)

- (0) NONE
(1) BUILDING
(2) SIGN
(3) VEGETATION (E.G. BUSHES, SHRUBS)
(4) TREE
(5) HILL OR CURVE IN ROAD
(6) VEHICLE IN TRANSPORT
(7) OTHER:
(8) PARKED VEHICLE
(9) UNKNOWN

39

ENVIRONMENTAL CONDITIONS

SPEED LIMIT

- (0) 5-45 km/h 5-25 mph
 (1) 46-55 30
 (2) 56-60 35
 (3) 61-70 40
 (4) 71-79 45
 (5) 80-85 50
 (6) 86-90 55
 (7) 91-105 60
 (8) OVER 105 65
 (9) UNKNOWN

PRECIPITATION

- (0) NONE
 (1) RAIN
 (2) SNOW
 (3) HAIL
 (4) FREEZING RAIN/SLEET
 (7) OTHER: _____
 (9) UNKNOWN

RATE OF PRECIPITATION

- (1) LIGHT/MIST
 (2) MODERATE
 (3) HEAVY
 (8) NOT APPLICABLE
 (9) UNKNOWN

TEMPERATURE

- (0) BELOW -15° C BELOW 5° F
 (1) -15 TO -6 5 TO 22
 (2) -5 TO -1 23 TO 31
 (3) 0 TO 2 32 TO 36
 (4) 3 TO 5 37 TO 41
 (5) 6 TO 15 42 TO 59
 (6) 16 TO 25 60 TO 77
 (7) 26 TO 35 78 TO 95
 (8) OVER 35 OVER 96
 (9) UNKNOWN

CROSSWIND

- (0) NONE
 (1) LIGHT
 (2) STRONG
 (3) GUSTY & STRONG
 (9) UNKNOWN

LIGHT CONDITIONS

- (1) DAYLIGHT
 (2) DAWN
 (3) DUSK
 (4) DARK, LIGHTED
 (5) DARK, UNLIGHTED
 (6) DARK, UNKNOWN IF LIGHTED
 (9) UNKNOWN

MECHANICAL MALFUNCTION

WAS THERE MENTION
OF A MECHANICAL MALFUNCTION
IN CASE VEHICLE

- (0) NO
 (1) YES
 (2) YES, DID NOT CONTRIBUTE
TO ACCIDENT
 (9) UNKNOWN

THE FOLLOWING SECTION SHOULD BE FILLED
OUT IF A MECHANICAL MALFUNCTION IS
RECOGNIZED OR SUSPECTED.

CIRCLE ITEMS INVOLVED. SUPPORT ANY
ITEMS CIRCLED WITH COMMENTS.

BRAKE SYSTEM	DRIVER CONTROLS
EXHAUST SYSTEM	POWER TRAIN
STEERING SYSTEM	FUEL SYSTEM
SUSPENSION SYSTEM	VISIBILITY ITEMS
ELECTRICAL SYSTEM	TIRES
THROTTLE CONTROLS	UNKNOWN

OTHER: _____

COMMENTS: _____

CRASH DETAILS

CASE VEHICLE AND OBJECT

- (0) NO
(1) YES
(9) UNKNOWN

1

47

CASE VEHICLE ROLLOVER

- (0) NO ROLLOVER
(1) YES, FIRST EVENT
(2) YES, SUBSEQUENT EVENT
(3) YES, SEQUENCE UNKNOWN
(9) UNKNOWN

0

48

CASE VEHICLE RAN OFF ROADWAY
(BEFORE FIRST IMPACT)

- (0) NO
(1) YES
(9) UNKNOWN

1

49

MOVING CASE VEHICLE AND
CONTACTED MOVING VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

0

50

CASE VEHICLE AND
CONTACTED STOPPED VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

0

51

STOPPED CASE VEHICLE AND
CONTACTED VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

0

52

TOTAL NUMBER
OF VEHICLES CONTACTED
BY CASE VEHICLE IN CRASH

- (8) 8 OR MORE
(9) UNKNOWN

0

53

ANY FIRE IN THIS CRASH
(NOT JUST CASE VEHICLE)

- (0) NO
(1) YES
(9) UNKNOWN

0

54

HIGHEST POLICE INJURY
SEVERITY CODE IN CRASH
(NOT JUST CASE VEHICLE)

- (0) O - NO INJURY
(1) C - POSSIBLE INJURY
(2) B - NON-INCAPACITATING INJURY
(3) A - INCAPACITATING INJURY
(4) K - FATAL
(5) INJURED, SEVERITY UNKNOWN
(6) DIED PRIOR TO ACCIDENT
(7) NON-FATAL INJURY
SEVERITY UNKNOWN
(9) UNKNOWN

2

55

DRIVER IMPAIRMENT

DRIVER ALCOHOL INVOLVEMENT
(CASE VEHICLE)

- (0) NONE
(1) YES
(9) UNKNOWN/NOT REPORTED/
NO DRIVER

0

56

DRIVER ALCOHOL BAC
(CASE VEHICLE)

- (80) NO TEST
(90) CHEMICAL TESTS, NO RESULTS
(95) AUTOPSY, NO RESULTS
(99) UNKNOWN

80

57 58

WAS THERE MENTION OF DRIVER
IMPAIRMENT FOR CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

0

59

LIST IMPAIRMENTS MENTIONED:

Post - CRASH DETAIL

MANNER CASE VEHICLE
LEFT SCENE

- (1) DRIVEN
(2) TOWED DUE TO DAMAGE
(3) TOWED, NOT DUE TO DAMAGE
(4) TOWED, REASON UNKNOWN
(9) UNKNOWN

2

60

ACCIDENT SCHEMATIC

ACCIDENT DESCRIPTION: Case vehicle (A) was traveling north and made a right turn onto a gravel road. The driver lost control of case vehicle (A) and the vehicle exited the road and struck a tree with its left-front.

CASE VEHICLE (A): 1999 Ford Ranger PU


OTHER VEHICLE (B): _____

THIRD VEHICLE (C): _____

GI-4



NORTH

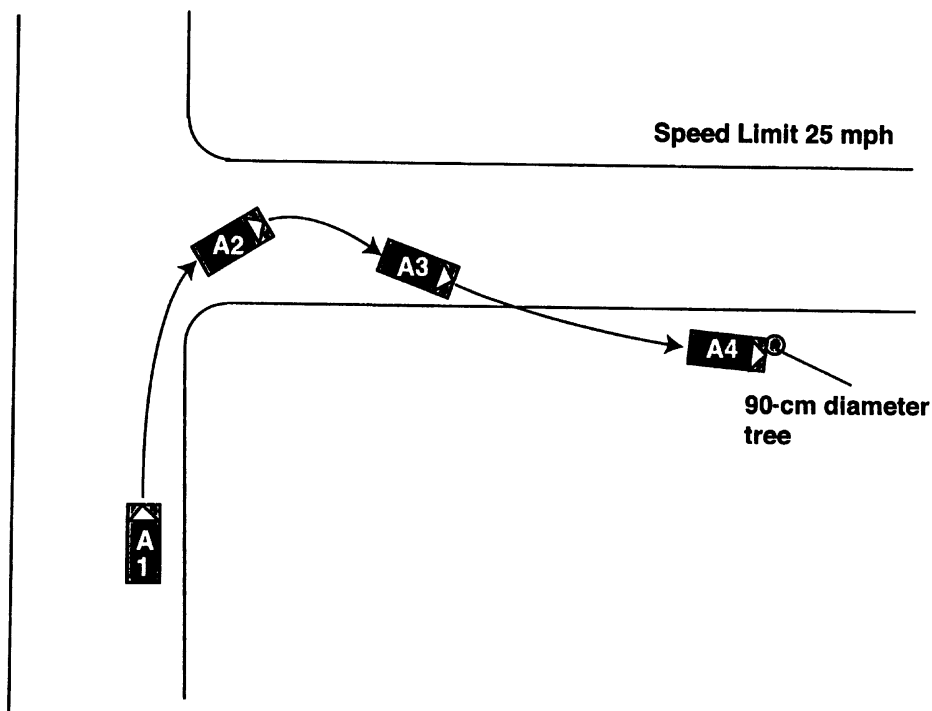

Duplicate columns 1-8
from the previous card.

Module O V Format 0 4
9 10 11 12

OTHER VEHICLE OV-1

MAKE: _____
MODEL: NOT APPLICABLE

CARGO: _____

VIN

13

29

MANUFAC/BODY CODE

30

34

MAKE/MODEL CODE

38

MODEL YEAR

39

42

VEHICLE MASS (kg)

43

48

IF SEPARATE REPORT WAS MADE,
GIVE VEHICLE NUMBER

NUMBER OF OCCUPANTS
(ENTER 9'S IF UNKNOWN)

51

TRAVELING SPEED (km/h)

54

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY
CODE FOR THIS VEHICLE

- (0) O - NO INJURY
(1) C - POSSIBLE INJURY
(2) B - NON-INCAPACITATING INJURY
(3) A - INCAPACITATING INJURY
(4) K - FATAL
(5) INJURED, SEVERITY UNKNOWN
(6) DIED PRIOR TO ACCIDENT
(7) NON-FATAL INJURY
SEVERITY UNKNOWN
(8) UNOCCUPIED VEHICLE
(NOT APPLICABLE)
(9) UNKNOWN

55

VEHICLE TYPE

PASSENGER VEHICLE

- (02) LARGE
(03) LIMOUSINE
(17) PICKUP CAR
(20) UNKNOWN PASSENGER VEHICLE BODY
(24) SUB-MINI
(25) MINI
(26) SUB-COMPACT
(27) COMPACT
(28) INTERMEDIATE
(29) FULL

56

57

MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
(15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(17) PICKUP CAR WITH CANOPY/SHELL COVER
(21) MOTOR HOME
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(23) PICKUP CAR WITH SLIDE-IN CAMPER
(31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) VAN
(12) PICKUP TRUCK
(13) UNKNOWN LIGHT TRUCK
(15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(30) UNKNOWN TRUCK TYPE
(31) CHASSIS-MOUNTED CAMPER
(33) DELIVERY VAN (WALK-IN)
(34) STRAIGHT TRUCK
(35) TRUCK-TRACTOR (BOBTAIL)
(36) CHASSIS-CAB
(37) UNKNOWN HEAVY TRUCK
(38) TRACTOR & SEMI-TRAILER (SEMI)
(39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
(41) SCHOOL BUS
(42) INTERCITY BUS (BETWEEN CITIES)
(43) TRANSIT BUS (INTRACITY)
(44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)
(69) LOCOMOTIVE (ENGINE, SWITCHER)

- (99) UNKNOWN

WHEELBASE (cm)

- (999) UNKNOWN

58 59 60

Duplicate columns 1-8
from the previous card.

Module 0 V Format 0 2
9 10 11 12

OTHER VEHICLE OV-2

ORIGINAL SPECIFICATIONS

Wheelbase	_____ cm	Front Overhang	_____ cm
			22 _____ 24
Curb Weight	_____ kg	Rear Overhang	_____ cm
			25 _____ 27
Average Track Width	_____ cm	Undeformed End Width (UEW)	_____ cm
	13 _____ 15		28 _____ 30
Overall Length	_____ cm	Engine Displacement	_____ L
	16 _____ 18		31 _____ 32
Overall Width (OAW)	_____ cm	Engine: # of Cylinders	_____
	19 _____ 21		33 _____ 34

VEHICLE DAMAGE

NOT APPLICABLE

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) _____ cm
35 _____ 37

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$ _____ %
38 39

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$ _____ %
40 41

- Duplicate columns 1-8
from the previous card.

Module V D Format 0 4
9 10 11 12

VEHICLE DESCRIPTION VD-1

MAKE: Ford

CARGO: _____

MODEL: Ranger XL, 4x4

VIN 1 F T Z R 1 5 X 6 X T [REDACTED]
13 29

MANUFAC/BODY CODE 1 2 1 1 2
30 34

MAKE/MODEL CODE 3 1 2 0
38

MODEL YEAR 1 9 9 9
39 42

VEHICLE MASS (kg) 0 0 1 6 1 5
43 48

ODOMETER (km)
(ENTER 9'S IF UNKNOWN) 0 4 7 7 8 3
(ENTER 8'S IF ELECTRONIC) 49 54

NUMBER OF OCCUPANTS 0 2
(ENTER 9'S IF UNKNOWN) 56

TRAVELING SPEED (km/h) 9 9 8
59

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

STOLEN VEHICLE

- (0) NO
(1) YES
(8) NOT COLLECTED
(9) UNKNOWN

8
62

BODY STRUCTURE

- (1) BODY & FRAME
(2) UNITIZED
(3) INTEGRAL-STUB FRAME
(4) BODY & PLATFORM FRAME
(E.G. VW BUG)
(5) PARTIALLY UNITIZED
(7) OTHER: _____
(9) UNKNOWN

1
63

TRANSMISSION

- (0) NONE
(1) AUTOMATIC
(2) MANUAL
(9) UNKNOWN

1
64

VEHICLE TYPE

PASSENGER VEHICLE

- (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR)
(12) 2-DOOR SEDAN OR COUPE
(ANY UPPER B-PILLAR)
(13) 4-DOOR HARDTOP
(14) 4-DOOR SEDAN
(15) STATION WAGON
(16) CONVERTIBLE
(18) OTHER PASS. VEH. : _____
(19) PASSENGER VEHICLE, TYPE UNKNOWN

3 2
60 61

MULTIPURPOSE PASSENGER VEHICLE

- (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO)
(22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(23) VAN, SIZE UNKNOWN
(24) VAN, SMALL (MINI)
(25) VAN, LARGE
(29) MPV, TYPE UNKNOWN
(30) MOTOR HOME

TRUCK

- (31) PICKUP TRUCK, UNKNOWN
(32) PICKUP TRUCK, SMALL (DOWNSIZED)
(33) PICKUP TRUCK, LARGE

(99) UNKNOWN

LOCATION OF TRANSMISSION
SELECTOR LEVER

- (1) FLOOR
(2) CONSOLE
(3) COLUMN
(7) OTHER: _____
(9) UNKNOWN

3
65

STEERING



- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
66

BRAKES

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
67

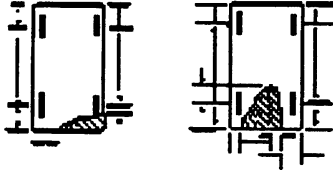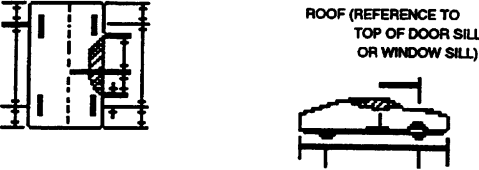TYPE OF BRAKES	$\frac{2}{68}$	WHEELBASE (cm) (999) Unknown	$\frac{320}{76 \quad 77 \quad 78}$
(1) DRUM, ALL WHEELS (2) DISC, FRONT WHEELS (3) DISC, ALL WHEELS (9) UNKNOWN			
BRAKE ANTI-LOCK DEVICE	$\frac{1}{69}$	PLASTIC ANTI-LACERATIVE INNER LAYER GLASS EQUIPPED	$\frac{0}{79}$
(0) NONE INSTALLED (1) TWO-WHEEL (2) FOUR-WHEEL (7) EQUIPPED, UNKNOWN WHEELS (9) UNKNOWN		(0) NONE (1) WINDSHIELD (2) WINDSHIELD AND SIDE (7) OTHER (9) UNKNOWN	
AIR CONDITIONING IN VEHICLE	$\frac{8}{70}$		
(0) NO (1) YES (8) NOT COLLECTED (9) UNKNOWN			
TYPE OF DRIVE	$\frac{3}{71}$	FIELD INVESTIGATOR INSTRUCTIONS: 1. <u>INDICATE CRUSHED AREAS BY OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.</u> 2. <u>ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE.</u> 3. <u>ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR.</u> 4. <u>ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.</u> EXAMPLES:	
(1) REAR WHEEL (2) FRONT WHEEL (3) FOUR WHEEL (4) ALL WHEEL DRIVE (9) UNKNOWN			
DUAL REAR WHEELS	$\frac{0}{72}$		
(0) NO (1) YES (9) UNKNOWN			
ORIGINAL TYPE OF RESTRAINT SYSTEM	$\frac{3}{73}$		
(1) ACTIVE BELT (2) PASSIVE BELT (3) AIRBAG (4) KNEE BOLSTERS (7) OTHER: _____ (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN			
EQUIPPED WITH ROLL BAR	$\frac{0}{74}$	FRONT OR REAR	
(0) NO (1) YES (9) UNKNOWN			
TYPE OF ROOF	$\frac{1}{75}$	SIDE	
(0) NONE (1) SOLID (2) T-TOP CLOSED (3) T-TOP OPEN (4) SUN ROOF CLOSED (5) SUN ROOF OPEN (6) CONVERTIBLE CLOSED (7) CONVERTIBLE OPEN (8) OTHER: _____ (9) UNKNOWN			ROOF (REFERENCE TO TOP OF DOOR SILL OR WINDOW SILL)

ORIGINAL SPECIFICATIONS

Wheelbase 320 cm

Front Overhang 085 cm
22 24

Curb Weight 1615 kg

Rear Overhang 111 cm
25 27

Average Track Width 147 cm
13 15

Undeformed End Width (UEW) 150 cm
28 30

Overall Length 515 cm
16 18

Engine Displacement 4.0 L
31 32


Overall Width (OAW) 179 cm
19 21

Engine: # of Cylinders 06
33 34

VEHICLE DAMAGE

MEASUREMENTS IN CENTIMETERS

Both front fenders, bumper and hood removed prior to inspection

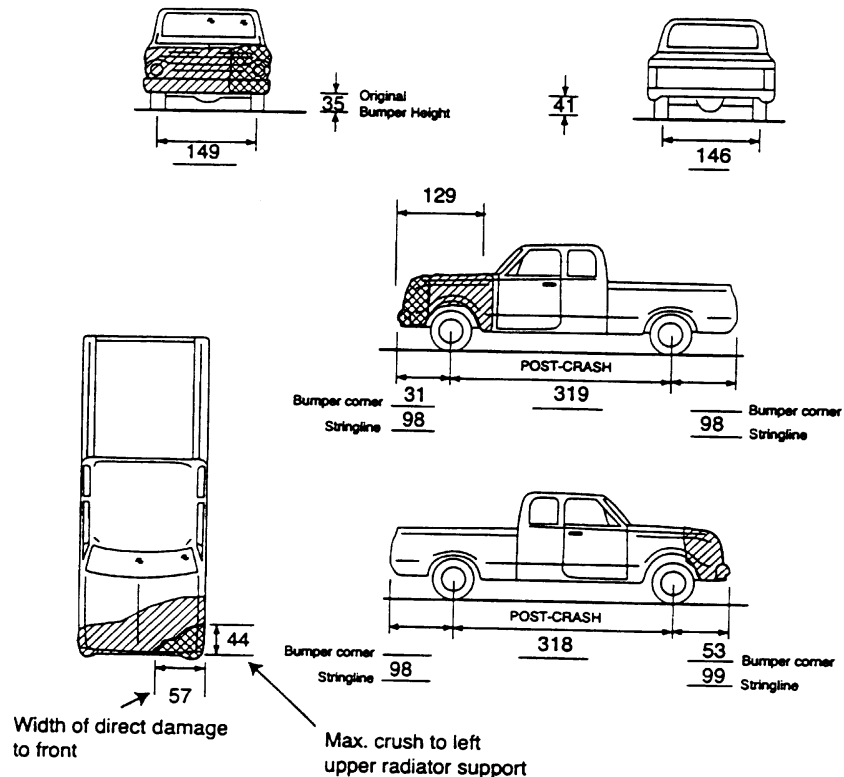

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 057 cm
35 37

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$ 38 %
38 39

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$ 40 %
40 41

Duplicate columns 1-8
from the previous card.

Module D A Format 0 2
9 10 11 12

DAMAGE DA-1

PRIMARY

CASE VEHICLE PRIMARY CDC

CONTACTED VEHICLE ASSOCIATED CDC

EVENT NUMBER

1
13

IMPACT SPEED (km/h)

999
14 15 16

ESTIMATED BY

1
17

CRUSH (cm)

044
18 19 20

CDC #1

12.FYEW.2
21 27

CDC #2

98.0000.0
28 34

998
35 36 37

8
38

998
39 40 41

98.0000.0
42 48

98.0000.0
49 55

Duplicate columns 1-8
from the previous card.

Module D A Format 0 3
9 10 11 12

SECONDARY

CASE VEHICLE SECONDARY CDC

CONTACTED VEHICLE ASSOCIATED CDC

EVENT NUMBER

13

IMPACT SPEED (km/h)

14 15 16

ESTIMATED BY

17

CRUSH (cm)

18 19 20

CDC #1

21 27

CDC #2

28 34

35 36 37

38

39 40 41

42 48

49 55

CODES

EVENT NUMBER

(8) NOT APPLICABLE
(9) UNKNOWN

IMPACT SPEED

(998) NOT APPLICABLE
(999) UNKNOWN

IMPACT SPEED ESTIMATOR

(1) INVESTIGATOR
(2) DRIVER
(3) POLICE
(4) "CRASH" PROGRAM
(5) OTHER COMPUTER PROGRAM
SPECIFY: _____
(7) OTHER: _____
(8) NOT APPLICABLE
(NO VEHICLE/NO IMPACT)

CRUSH

(998) NOT APPLICABLE
(NO VEHICLE/DAMAGE)
(999) UNKNOWN

CDC

(9800000) NOT APPLICABLE
(9900000) UNKNOWN

MAXIMUM SHEET METAL CRUSH

(cm) (999) UNKNOWN

FRONT 0 4 4
 13 15

RIGHT SIDE 0 0 0
 16 18

REAR 0 0 0
 19 21

LEFT SIDE 0 0 2
 22 24

ROOF 0 0 0
 25 27

OTHER 0 0 0
28 30

CHRONOLOGICAL SEQUENCE OF DAMAGE/INJURY PRODUCING CRASH EVENTS FOR CASE VEHICLE

NOTE: IF CHRONOLOGICAL ORDER IS UNKNOWN, EVENT ORDER IS OPTIONAL.

**DO YOU KNOW THIS TABLE
TO BE IN CHRONOLOGICAL ORDER?**

(0) NO
(1) YES

EVENT NUMBER	IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN	IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3.	OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4.
# 1	<u>4</u> 32	<u>17</u> 34	<u>77 tree</u> 36
#2	<u> </u> 37	<u> </u> 39	<u> </u> 41
#3	<u> </u> 42	<u> </u> 44	<u> </u> 46
#4	<u> </u> 47	<u> </u> 49	<u> </u> 51
#5	<u> </u> 52	<u> </u> 54	<u> </u> 56
#6	<u> </u> 57	<u> </u> 59	<u> </u> 61
#7	<u> </u> 62	<u> </u> 64	<u> </u> 66

CODES FOR
IMPACT CONFIGURATIONFRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

UNKNOWN

- (99) IMPACT TYPE UNKNOWN

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- (00) NO OBJECT
- (01) - (39) PASSENGER VEHICLE & TRUCK
- (40) - (69) OTHER VEHICLE
- (70) - (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) - (97) OFF-ROADWAY OBJECT

- (98) OTHER (DESCRIBE)
- (99) UNKNOWN

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZE	WHEELBASE
SUB-MINI	< 2286 mm (< 90")
MINI	2286 - 2412 mm (90" - 94.9")
SUB-COMPACT	2413 - 2539 mm (95" - 99.9")
COMPACT	2540 - 2666 mm (100" - 104.9")
INTERMEDIATE	2667 - 2793 mm (105" - 109.9")
FULL	2794 - 2920 mm (110" - 114.9")
LARGE	2921 - 3174 mm (115" - 124.9")
LIMOUSINE	> 3175 mm (> 125")

MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 - 75 cc
- (52) 76 - 125 cc
- (53) 126 - 250 cc
- (54) 251 - 500 cc
- (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING
ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM
OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE
MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION
- (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES

Duplicate columns 1-8
from the previous card.

Module C R Format 0 1
9 10 11 12

CRASH RECONSTRUCTION CR-1

for ΔV

	CASE VEHICLE PRIMARY IMPACT			CASE VEHICLE SECONDARY IMPACT		
	CASE VEHICLE	CONTACTED VEHICLE		CASE VEHICLE	CONTACTED VEHICLE	
EVENT NUMBER	<u>1</u> 13	<u>Tree</u>		<u>47</u>		
ΔV (km/h) TOTAL	<u>037</u> 14 15 16	<u>8</u> 32 33 34		<u>48 49 50</u>	<u>66 67 68</u>	
LONGITUDINAL*	<u>-037</u> 17 20	<u>8</u> 35 38		<u>51 54</u>	<u>69 72</u>	
LATERAL*	<u>+000</u> 21 24	<u>8</u> 39 42		<u>55 58</u>	<u>73 76</u>	
*NOTE: THESE ΔV COMPONENTS MUST INCLUDE SIGN.						
EXAMPLES: 10 km/h = <u>+010</u> -7 km/h = <u>-007</u>						
ENERGY DISSIPATED BY CRUSH (kj)	<u>0104</u> 25 28	<u>8</u> 43 46		<u>59 62</u>	<u>77 80</u>	
RECONSTRUCTION						
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30			<u>63 64</u>		
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL						
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL						
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL						
NOT RECONSTRUCTED BECAUSE						
(02) INSUFFICIENT DATA						
(03) EXCESSIVE UNDERRIDE/OVERRIDE						
(04) ROLLOVER						
(05) VAULTING						
(06) OTHER TRAVEL IN MORE THAN ONE PLANE						
(07) NON-HORIZONTAL FORCE						
(08) SIDESWIPE-TYPE DAMAGE						
(09) YIELDING OBJECT						
(10) OTHER: _____						
(11) AT LEAST ONE VEHICLE BEYOND SCOPE						
(12) OTHER VEHICLE NOT INSPECTED						
MODE						
(1) CDC ONLY						
(2) CDC & DETAILED DAMAGE	<u>2</u> 31			<u>65</u>		
(3) TRAJECTORY & CDC						
(4) TRAJECTORY & CDC & DETAILED DAMAGE						
(5) NOT RECONSTRUCTED						
COMPUTER PROGRAM SPECIFY: <u>WIDMASA</u>						

Duplicate columns 1-8
from the previous card.

Module C R Format 0 2
9 10 11 12

CRASH RECONSTRUCTION CR-2

for EBS

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13	<u>Tree</u>	<u> </u> 47	
EBS (km/h) TOTAL	<u>037</u> 14 15 16	<u>8—</u> 32 33 34	<u> </u> 48 49 50	<u> </u> 66 67 68
LONGITUDINAL*	<u>-037</u> 17 20	<u>8—</u> 35 38	<u> </u> 51 54	<u> </u> 69 72
LATERAL*	<u>+000</u> 21 24	<u>8—</u> 39 42	<u> </u> 55 58	<u> </u> 73 76
*NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = <u>+010</u> -7 km/h = <u>-007</u>				
ENERGY DISSIPATED BY CRUSH (kj)	<u>0104</u> 25 28	<u>8—</u> 43 46	<u> </u> 59 62	<u> </u> 77 80
RECONSTRUCTION				
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30		<u> </u> 63 64	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY				
(2) CDC & DETAILED DAMAGE	<u>2</u> 31		<u> </u> 65	
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: <u>MISSP4</u>				

- NOTES:
1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
 2. MEASURE C_1 TO C_6 FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
 3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
 4. USE THE CENTER OF THE WHEELBASE AS THE CG.

CASE VEHICLE

LOCATOR


Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	Begin LFB 57cm to right	Upper Rad support

VIEW = 150

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other _____
- (9) Unknown

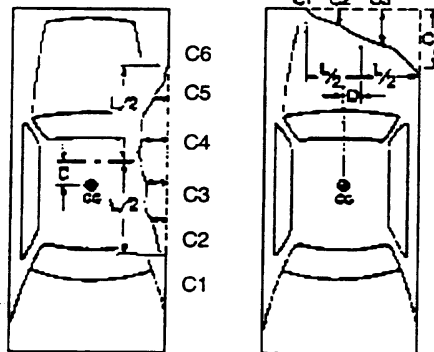

DL 57

UDL 93

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	±D
		Length (DDL)	Max Crush								
1	2	57	-67	132	67	56	50	45	41	45	-46
	stano Adjust		-13		-13	-13	-13	-13	-13	-13	
			-10		-10	-1	-1	-1	-7	-10	
1	2	057	044	132	044	042	036	031	021	022	-046
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2											

NOTES: 1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.

2. MEASURE C₁ TO C₆ FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.

3. *D* IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.


4. USE THE CENTER OF THE WHEELBASE AS THE CG.

OTHER VEHICLE

LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L

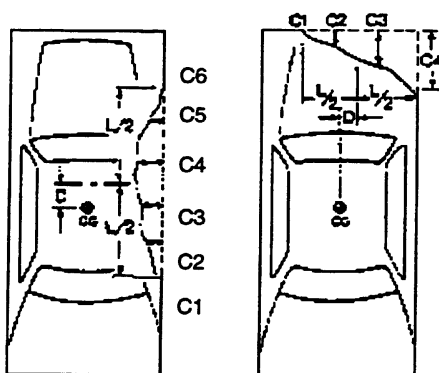

PLANE:

- (1) Bumper
(2) Above Bumper
(3) Sill
(4) Above Sill
(5) Other _____
(9) Unknown

DL

UDL

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

[illegible]

Duplicate columns 1-8
from the previous card.

Module W T Format 0 1
9 10 11 12

WHEELS AND TIRES

WT-1

WHEELS--DAMAGED

- (0) NO
(1) YES
(9) UNKNOWN

LF 0
13

RF 0

RR 0

LR 0
16

Flat

TIRE TREAD TYPE

- (1) REGULAR
(2) SNOW
(3) SLICKS
(4) ALL WEATHER (MS)
(7) OTHER: _____
(9) UNKNOWN

LF 4
17

RF 4

RR 4

LR 4
20

CARCASS CONSTRUCTION

- (1) BIAS
(2) BELTED BIAS
(3) RADIAL
(4) ELLIPTICAL
(5) HI PRESSURE SPARE
(6) SPACE SAVER SPARE
(7) OTHER: _____
(9) UNKNOWN

LF 3
21

RF 3

RR 3

LR 3
24

SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S)

LF P 2 4 5 7 5 R 1 6
25

RF ↓
35

RR P 2 3 5 7 5 R 1 5
45

LR P 2 4 5 7 5 R 1 6
55

*Replacement for
towing*

IF VEHICLE IS EQUIPPED WITH DUAL
WHEELS, COMPLETE FOR OUTER WHEELS
AND MAKE NOTES ON INNER WHEELS.

NOTES: _____

Duplicate columns 1-8
from the previous card.

Module F T Format 0 1
9 10 11 12

FUEL AND FUEL TANKS FT-1

TYPE OF PROPULSIVE FUEL

- (1) GASOLINE
- (2) DIESEL OIL
- (3) LPG
- (4) ELECTRIC
- (7) OTHER: _____
- (9) UNKNOWN

1
13

AUXILIARY TANK TYPE

- (1) OEM TANK
- (2) AFTER MARKET TANK
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

8
21

MAIN TANK LOCATION

322
14 16

AUXILIARY TANK LOCATION

888
22 24

MAIN FILLER CAP LOCATION

313
17 19

AUXILIARY FILLER CAP LOCATION

888
25 27

MAIN TANK MATERIAL

3
20

AUXILIARY TANK MATERIAL

8
28

TANK AND FILLER CAP LOCATION CODES

FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F L Format 0 1
9 10 11 12

FUEL LEAKAGE FL-1

DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.

0
13

LEAK NUMBER	I LEAKING COMPONENT	II COMPONENT SOURCE	III TYPE OF DAMAGE	IV SEVERITY OF DAMAGE	V LOCATION OF LEAK	EVENT NUMBER
#1	<u>14</u> <u>15</u>	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u>21</u>
#2	<u>22</u> <u>23</u>	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u>29</u>
#3	<u>30</u> <u>31</u>	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u>37</u>
#4	<u>38</u> <u>39</u>	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u>45</u>
#5	<u>46</u> <u>47</u>	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u>53</u>

I LEAKING COMPONENT

TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN
- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

V LOCATION OF LEAK

FIRST DIGIT
(LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT
(LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F R Format 0 1
9 10 11 12

FIRE FR-1

WAS THERE FIRE IN OR ON CASE VEHICLE?

(0) NO SKIP PAGE.

(1) YES COMPLETE PAGE.

0
13

DID FIRE START IN CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

—
14

SEVERITY OF FIRE DAMAGE

- (1) MINOR
(2) MODERATE
(3) SEVERE
(9) UNKNOWN

—
16

FLAME PROPOGATION RATE

- (1) RAPID/EXPLOSIVE
(2) SLOW/MODERATE
(9) UNKNOWN

—
15

DID AN INJURY TO CASE
VEHICLE OCCUPANT RESULT FROM
FIRE IN OR ON CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

—
17

PROVIDE NOTES IF FIRE OCCURRED.

Duplicate columns 1-8
from the previous card.

Module E D Format 0 1
9 10 11 12

EXTERIOR DAMAGE

ED-1

HOOD PERFORMANCE

FOR THE FOLLOWING, USE CODES:

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

HOOD LATCH(ES)- -RELEASED

9
13

-DAMAGED

9
14

-JAMMED

9
15

HOOD HINGES- -LEFT, DAMAGED

1
16

-LEFT, SEPARATED
(COMPLETE)

0
17

-RIGHT, DAMAGED

1
18

-RIGHT, SEPARATED
(COMPLETE)

0
19

HOOD REMAINED ON VEHICLE

1
20

REAR EDGE OF HOOD- -ELEVATED

1
21

-CONTACTED WINDSHIELD

1
22

-PENETRATED WINDSHIELD

0
23

HOOD LATCH LOCATION

- (1) FRONT OF VEHICLE
- (2) COWL AREA
- (3) SIDE
- (8) NOT APPLICABLE
- (9) UNKNOWN

1
24

ENGINE OR TRANSMISSION MOUNT

SEPARATION (COMPLETE)

- (0) NO
- (1) YES
- (9) UNKNOWN

0
25

STEERING COL FLEXIBLE COUPLING

FLEXIBLE COUPLING TYPE

- (0) NONE
- (1) FLEXIBLE MATERIAL
- (2) POT
- (3) SINGLE U-JOINT
- (4) DOUBLE U-JOINT
- (5) FLEXIBLE CABLE
- (6) COMBINATION OF ABOVE
(CIRCLE EACH)
- (7) OTHER: _____
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN, IF EQUIPPED

9
26

COUPLING- -DAMAGED

9
27

(USE CODES
FROM HOOD
PERFORMANCE)

-SEPARATED
(COMPLETE)

9
28

ENG COMPART TELESCOPING UNIT

TYPE OF UNIT

- (00) NONE INSTALLED
- (01) - (07) SEE UNITS ON PAGE ED-2
- (88) NOT COLLECTED
- (97) OTHER: _____
- (98) EQUIPPED, TYPE UNKNOWN
- (99) UNKNOWN IF EQUIPPED

8 8
29 30

ORIGINAL LENGTH (mm)

F (OR H): _____

TELESCOPED LENGTH (mm)

G: _____

DIFFERENCE (mm)

F (OR H) - G

(IF LESS THAN 15mm, ENTER "000")

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO
COMPRESSION
- (992) COMPRESSED, AMOUNT
UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT
EQUIPPED)
- (999) UNKNOWN

8 8 8
31 32 33

LEFT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

0
 34

LEFT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
 (2) DOOR-LATCH SEPARATION
 (3) LATCH-STRIKER SEPARATION
 (4) STRIKER-PILLAR SEPARATION
 (5) BODY DISTORTION
 (6) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (7) OPENED, REASON UNKNOWN

- (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

LEFT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

0
 35

LOWER

0
 36

-B-PILLAR, UPPER

0
 37

LOWER

0
 38

-C-PILLAR, UPPER

0
 39

LOWER

8
 40

-D-PILLAR, UPPER

8
 41

LOWER

8
 42

-FRONT

0
 43

-REAR

8
 44

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 45

-REAR

8
 46

REAR DOOR

REAR DOOR TYPE

- (0) NO DOOR (INCLUDES PICKUPS)
- (1) HATCHBACK
- (2) ONE-WAY TAILGATE
- (3) TWO-WAY TAILGATE
- (4) CLAMSHELL/DISAPPEARING TAILGATE
- (5) SINGLE DOOR
- (6) DOUBLE DOOR
- (9) UNKNOWN


Hatchback




One-way



Two-way



Clamshell



Single door



Double door

HOW DID DOOR
OPEN DURING COLLISION?

- (0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
- (2) DOOR-LATCH SEPARATION
- (3) LATCH-STRIKER SEPARATION
- (4) STRIKER-PILLAR SEPARATION
- (5) BODY DISTORTION
- (6) COMBINATION OF ABOVE
(CIRCLE EACH)
- (7) OPENED, REASON UNKNOWN
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

DOOR JAMMED CLOSED

- (0) NO
- (1) YES
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

47

48

49

OTHER REAR DAMAGE

WAS PARTITION TO LUGGAGE AREA
DAMAGED DURING COLLISION?

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

SPARE TIRE

- (0) NO SPARE TIRE
- (1) NOT ATTACHED BEFORE COLLISION
- (2) ATTACHED, NOT SEPARATED IN COLLISION
- (3) ATTACHED, SEPARATED DUE TO COLLISION
- (8) NOT COLLECTED
- (9) UNKNOWN

TRAILER HITCH TYPE

- (0) NO HITCH

BALL-AND-SOCKET TYPES

- (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON)
- (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK)
- (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING)
- (4) LOAD EQUALIZING

OTHER TYPES

- (5) RING-AND-PINTLE
- (6) FIFTH-WHEEL (INCL. P/U)
- (7) OTHER (E.G. CLEVIS-AND-PIN)
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN IF EQUIPPED

TRAILER TYPE
(AT TIME OF COLLISION)

- (0) NO TRAILER
- (1) TRAVEL-TRAILER/CAMPER
- (2) MOBILE HOME
- (3) BOAT/SNOWMOBILE/ATV TRAILER
- (4) UTILITY TRAILER
- (5) TOWED CAR
- (7) OTHER: _____
- (8) TRAILER, TYPE UNKNOWN
- (9) UNKNOWN

50

51

52

53

RIGHT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

0
 54

RIGHT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(00) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (01) HINGE AREA SEPARATION
 (02) DOOR-LATCH SEPARATION
 (03) LATCH-STRIKER SEPARATION
 (04) STRIKER-PILLAR SEPARATION
 (05) BODY DISTORTION
 (06) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (07) OPENED, REASON UNKNOWN
 (11) VAN RIGHT-REAR DOOR OPENED
 (ANY MECHANISM)

(98) NOT APPLICABLE (NO DOOR)

(99) UNKNOWN

-FRONT

0 0
 63 64

-REAR

2 2
 65 66

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 67

-REAR

8
 68

VAN REAR DOOR TYPE

- (0) VAN, NO REAR DOOR
 (1) TRACK (SLIDING) - RIGHT SIDE
 (2) SINGLE-HINGED - RIGHT SIDE
 (3) DOUBLE-HINGED - RIGHT SIDE
 (4) TRACK (SLIDING) - RIGHT & LEFT SIDE
 (5) SINGLE-HINGED - RIGHT & LEFT SIDE
 (6) DOUBLE-HINGED - RIGHT & LEFT SIDE
 (7) TRACK AND HINGED COMBINATION
 (8) NOT APPLICABLE (NOT A VAN)
 (9) UNKNOWN

8
 69

RIGHT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

0
 55

LOWER

0
 56

-B-PILLAR, UPPER

0
 57

LOWER

0
 58

-C-PILLAR, UPPER

0
 59

LOWER

8
 60

-D-PILLAR, UPPER

8
 61

LOWER

8
 62

WINDSHIELD DAMAGE

WINDSHIELD CRACKED

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

WINDSHIELD BROKEN
(PLASTIC INTERLAYER TORN)

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

CRACKED OR BROKEN
BY OCCUPANT CONTACT

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

EXTENT OF BOND SEPARATION

- (0) NONE
 (1) 1 - 20%
 (2) 21 - 40
 (3) 41 - 60
 (4) 61 - 80
 (5) 81 - 99
 (6) TOTAL
 (7) SEPARATED, AMOUNT
 UNKNOWN
 (8) NOT APPLICABLE
 (9) UNKNOWN

1
70

0
71

1
72

0
73

WINDSHIELD MARK ON CASE VEHICLE:

SOLAR TINT

Carlite

AS-1

(D)

(R)

LAMINATED

SUN VISOR

DOT-75 FM M207

9

D

LB

DW-1137

WINDSHIELD CODE

- (97) DESCRIBED BUT NOT CODED
 (98) NOT APPLICABLE (NO WINDSHIELD)
 (99) UNKNOWN

97
74 75


ROOF

DID T-ROOF/SUN ROOF OPEN
DURING COLLISION?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (NOT A T-ROOF OR SUN ROOF)
 (9) UNKNOWN

8
76

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

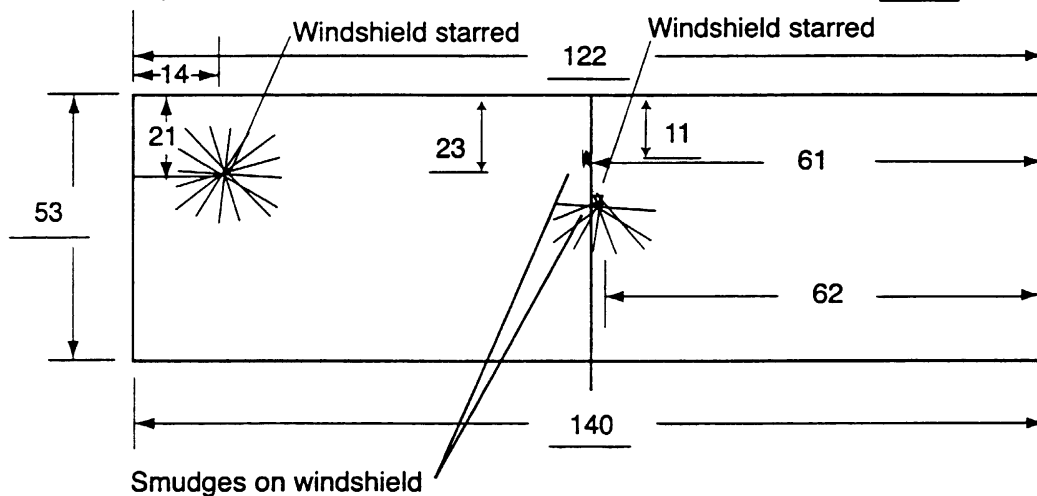

L

C

R

STEERING WHEEL

STEERING WHEEL RIM DAMAGE

- (0) NONE
- (1) DEFORMED SLIGHTLY
- (2) SEVERELY BENT
- (3) BROKEN
- (9) UNKNOWN

upper half

1
13

NUMBER OF STEERING WHEEL SPOKES

- (9) UNKNOWN

4
14

STEERING WHL SPOKE DAMAGE

- (0) NONE
- (1) DEFORMED SLIGHTLY
- (2) SEVERELY BENT
- (3) BROKEN
- (9) UNKNOWN

0
15

STEERING WHEEL POSITION AT TIME OF COLLISION

IN WHAT O'CLOCK POSITION WAS THE
NORMAL TOP OF THE WHEEL POINTED
WHEN THE COLLISION OCCURRED?

EXAMPLES

O'CLOCK = 12



(NORMAL STRAIGHT
AHEAD)

O'CLOCK = 92



O'CLOCK = 99

(99) UNKNOWN

STEERING WHEEL ENERGY ABSORBING DEVICE



(1) EXAMPLES:

BARRACUDA, 70 - 74
CHALLENGER, 70 - 74
CAPRI, 71 - 77



(2) EXAMPLES:

OMNI, 78 -
HORIZON, 78 -

STEERING COLUMN OPTIONS

TILT FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED, UNK POSITION
- (2) UP
- (3) MIDDLE
- (4) LOWER
- (9) UNKNOWN IF EQUIPPED

4
16

SWING-AWAY FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED
- (9) UNKNOWN IF EQUIPPED

0
17

TELESCOPING FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED
- (9) UNKNOWN IF EQUIPPED

0
18

TYPE OF DEVICE

- (0) NONE
- (1) CONVOLUTED OR MESH CYLINDER
- (2) DEEP DISH STEERING WHEEL
- (7) OTHER: _____
- (8) NOT COLLECTED
- (9) UNKNOWN IF EQUIPPED

8
19

ORIGINAL DIMENSION (mm)

A: _____

DAMAGE DIMENSION (mm)

B: _____

DIFFERENCE (mm)

A - B

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO APPARENT COMPRESSION
- (992) COMPRESSED, AMOUNT UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO MEASURE
- (998) NOT APPLICABLE (NOT EQUIPPED)
- (999) UNKNOWN

8 8 8
20 22

STEERING COLUMN ENERGY ABSORBING DEVICE

TYPE OF DEVICE * (IF 27 OR 28)

- (00) NOT EQUIPPED
(88) NOT COLLECTED
(99) UNKNOWN

$\frac{8}{23}$ $\frac{8}{24}$

ORIGINAL LENGTH (mm)

C: _____

COMPRESSED LENGTH (mm)

D: _____

BRACKET DEFLECTION (IF CODE 36, 48,
OR 49 ABOVE)

OR

COMPRESSION (OR EXTRUSION) (mm)

C - D (OR E) (TOLERANCE: ± 10)

- (888) NOT COLLECTED
(991) NOT MEASURED/NO APPARENT
COMPRESSION
(992) COMPRESSED, AMOUNT UNKNOWN
(993) DEVICE EXTENDED
(997) UNABLE TO BE MEASURED
(998) NOT APPLICABLE (NOT EQUIPPED)
(999) UNKNOWN


$\frac{8}{25}$ $\frac{8}{26}$ $\frac{8}{27}$

* (ADD A & B FOR TOTAL COMPRESSION)

SHEAR CAPSULE SEPARATION (mm)

S (USE AVG. OF LEFT & RIGHT CAPSULES.)

LT:

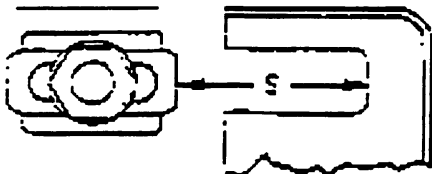

RT:

- (888) NOT COLLECTED
(991) NOT MEASURED/NO APPARENT
SEPARATION
(992) SEPARATED, AMOUNT UNKNOWN
(997) UNABLE TO BE MEASURED
(998) NOT APPLICABLE (NOT EQUIPPED)
(999) UNKNOWN

$\frac{8}{28}$ $\frac{8}{29}$ $\frac{8}{30}$

COLUMN VERTICAL ROTATION

- (0) NO APPARENT ROTATION
(1) UPWARD APPARENT ROTATION
(2) DOWNWARD APPARENT ROTATION
(9) UNKNOWN

$\frac{0}{31}$

COLUMN LATERAL ROTATION

- (0) NO APPARENT ROTATION
(1) LEFT APPARENT ROTATION
(2) RIGHT APPARENT ROTATION
(9) UNKNOWN

$\frac{0}{32}$

STEERING WHEEL (CONTINUED)

STEERING WHEEL HUB DAMAGE

- (0) NONE
(1) OCCUPANT CONTACT
(2) AIRBAG
(3) OTHER _____
(9) UNKNOWN

$\frac{0}{33}$

	INTRUSION IT-1
--	----------------

[illegible]

OCCUPANT CONTACT WORKSHEET									
----------------------------	--	--	--	--	--	--	--	--	--

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A					
B					
C					
D					
E					
F					
G					
H					
I					
J					

1 = Definitely 2 = Probably 3 = Possible


INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction
		Comparison Value	– Intruded Value	= Intrusion	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	

OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Windshield	DR		Glass cracked and smudge mark	2
B	Knee bolster	DR	Lt. knee	Black mark	3
C	Knee bolster	DR	Rt. knee	Scuff-mark	1
D	Windshield	RF	Head	Glass cracked and smudge mark	1
E	Windshield	RF	Head	Glass cracked and smudge mark	1
F	Rearview mirror	RF	Head	knocked off mount	1
G	Glove box	RF	Rt. knee	indentation	1
H					
I					
J					
K					

VEHICLE OCCUPANT CONTACT DIAGRAM

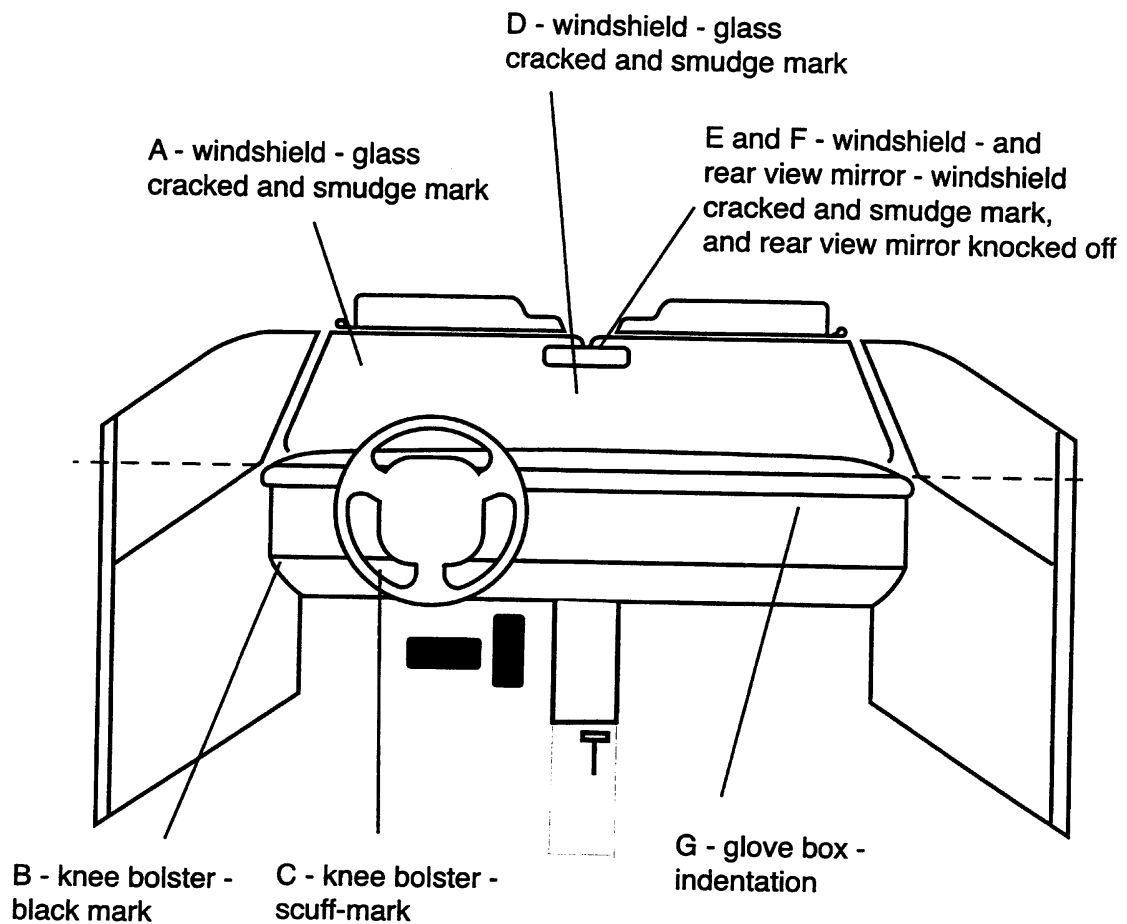

CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

- | | | | |
|--------------------------|-----------------|-------------------------|---|
| (1) LEFT | (3) RIGHT | | INDIVIDUAL SEAT |
| (1) LEFT | (2) CENTER | (3) RIGHT | BENCH: FULL WIDTH 3 PASSENGER |
| (1) LEFT | (2) LEFT CENTER | (6) RIGHT CENTER | (3) RIGHT BENCH: FULL WIDTH 4 PASSENGER |
| (1) LEFT | (2) CENTER | (5) RIGHT & AISLE SPACE | BENCH: PARTIAL WIDTH, LEFT |
| (0) LEFT & SPACE | (2) CENTER | (5) RIGHT & SPACE | BENCH: PARTIAL WIDTH, CENTERED |
| (4) ENTIRE VEHICLE WIDTH | | CARGO AREA | |

EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR
5 PASSENGERS

X	X	11	13
X	X	X	21 22 23

VAN
12 PASSENGER CAPACITY

X	X	11	13	
X	X	X	21 22 25	
X	X	X	31 32 35	
X	X	X	X	41 42 46 43

CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)
(Y) Y-AXIS (LATERAL)
(Z) Z-AXIS (VERTICAL)

CODES FOR COLUMNS G, H, I & J, OCCUPANT & INJURY NUMBERS

OCCUPANT NUMBER	INJURY NUMBER	<u>CONTACT</u>
(00)	(00)	NO CONTACT
(##)	(00)	CONTACT, NO INJURY
(97)	(99)	CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN
(99)	(00) OR (99)	UNKNOWN IF CONTACT

CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

INDIVIDUAL COMPONENT

INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/
SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (*DESCRIBE*)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER
COMPARTMENT BUT PART
OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (*E.G. SPARE TIRE,
JACK. DESCRIBE.*)
- (49) UNKNOWN EXTERNAL OBJECT

GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

*USE ONLY IF ALL THESE COMPONENTS
INTRUDED INTO A SINGLE OCCUPANT SPACE.*

- | | |
|------------------------|-------------------------|
| (50) WINDSHIELD HEADER | (60) ROOF |
| A-PILLAR | ROOF RAIL |
| ROOF SIDE RAIL | A-PILLAR |
| | B-PILLAR |
| | C-PILLAR |
| (51) INSTRUMENT PANEL | WINDOW FRAME |
| A-PILLAR | DOOR PANEL |
| DOOR PANEL | FLOOR PAN |
| (52) INSTRUMENT PANEL | (61) INSTRUMENT PANEL |
| A-PILLAR | TOE PAN |
| WINDSHIELD HEADER | WINDSHIELD HEADER |
| | A-PILLAR |
| (53) DOOR PANEL | ROOF RAIL |
| B-PILLAR | WINDOW FRAME |
| ROOF RAIL | DOOR PANEL |
| | ROOF |
| (54) DOOR PANEL | (62) ROOF |
| A-PILLAR | ROOF RAIL |
| ROOF RAIL | C-PILLAR |
| | WINDOW FRAME |
| (55) INSTRUMENT PANEL | FLOOR PAN |
| FLOOR PAN | SECOND SEAT |
| A-PILLAR | DOOR PANEL |
| DOOR FRAME | |
| (56) ROOF RAIL | (63) ROOF RAIL |
| A-PILLAR | ROOF |
| B-PILLAR | B-PILLAR |
| WINDOW FRAME | WINDOW FRAME |
| | FLOOR PAN |
| (57) ROOF RAIL | DOOR PANEL |
| A-PILLAR | SECOND SEAT |
| B-PILLAR | FRONT SEAT |
| C-PILLAR | |
| DOOR PANEL | (64) ROOF RAIL |
| | ROOF OR CONVERTIBLE TOP |
| (58) ROOF | A-PILLAR |
| ROOF RAIL | B-PILLAR |
| WINDOW FRAME | WINDOW FRAME |
| DOOR PANEL | WINDOW HEADER |
| (59) BACKLIGHT HEADER | (65) WINDSHIELD |
| ROOF | WINDSHIELD HEADER |
| C-PILLAR | ROOF SIDE RAIL |
| THIRD SEAT-BACK | |
| | (66) WINDSHIELD |
| | WINDSHIELD HEADER |
| | A-PILLAR |
| | |
| | (98) NOT APPLICABLE |
| | (99) UNKNOWN |

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 1
9 10 11 12

INTRUSION IT-5

WAS THERE OCCUPANT COMPARTMENT INTRUSION? 0

13

WAS INTRUSION CATASTROPHIC?

14

- (0) NO DO NOT ANSWER NEXT QUESTION. SKIP PAGE.
(1) YES ANSWER NEXT QUESTION.
(9) UNKNOWN SKIP PAGE.

- (0) NO COMPLETE PAGE.
(1) YES SKIP PAGE.

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 2
9 10 11 12

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 1</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 2</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 3</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 4</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 5</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 6</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 7</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —

NOTE: USE ADDITIONAL PAGE IF MORE THAN 7 INTRUSIONS.

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 3
9 10 11 12

NOTE: IF NO SIDE DOOR INTRUSION,
SKIP REMAINDER OF PAGE.

**SIDE DOOR INTRUSION
RESULTED FROM**

INTRUSION
NUMBER CAUSE

CODES
FOR CAUSE:

13 — (1) DIRECT
16 — (2) IMPACT
18 — (2) INDUCED
19 — (9) DAMAGE
21 — (9) UNKNOWN

**IF DAMAGE TO DOOR COMPONENT RESULTED IN INCREASED
DOOR INTRUSION, CODE COMPONENT**

INTRUSION
NUMBER

DAMAGED
COMPONENT 1

DAMAGED
COMPONENT 2

CODES
FOR COMPONENTS

A — —
22 23

B — —
26 27

C — —
30 31

D — —
34 35

—

—

—

—

25

29

33

37

- (0) NONE
(1) A-PILLAR
(2) B-PILLAR
(3) C-PILLAR
(4) LATCH/STRIKER
(5) HINGES
(7) OTHER:
(8) NOT APPLICABLE
(9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module I T Format 0 2
9 10 11 12

INTRUSION IT-6

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

-- ADDITIONAL PAGE --

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 8</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 9</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 0</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 1</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 2</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 3</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 4</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 5</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 6</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 7</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 8</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 9</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 0</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 1</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 2</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 3</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 4</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 5</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —

Duplicate columns 1-8
from the previous card.

Module I D Format 0 1
9 10 11 12

INTERIOR DAMAGE

ID-1

CODES:

(0) NO
(1) YES
(3) NO, and OCCUPANT CONTACT

(4) YES, and OCCUPANT CONTACT
(8) NOT APPLICABLE
(9) UNKNOWN

	LEFT	RIGHT				
SIDES			FRONT			INSTRUMENT PANEL
FRONT DOOR	<u>0</u> 13	<u>0</u> 14	FOOT CONTROLS	<u>0</u> 45		UPPER PANEL
FRONT HARDWARE	<u>0</u> 15	<u>0</u> 16	IGNITION KEYS	<u>0</u> 46		MID PANEL
FRONT ARMREST	<u>0</u> 17	<u>0</u> 18	REAR VIEW MIRROR	<u>4</u> 47		LOWER PANEL
FRONT GLASS	<u>0</u> 19	<u>0</u> 20	SUNVISOR/FITTINGS	<u>0</u> 48		ASHTRAY
REAR DOOR AREA	<u>0</u> 21	<u>0</u> 22	(5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES			CONTROL KNOBS & LEVERS
REAR HARDWARE	<u>0</u> 23	<u>0</u> 24	WINDSHIELD TOP MOLDINGS	<u>0</u> 49		GLOVE COMPARTMENT AREA
REAR ARMREST	<u>8</u> 25	<u>8</u> 26	LEFT A-PILLAR (UPPER OR LOWER)	<u>0</u> 50		INSTRUMENTS
REAR GLASS	<u>0</u> 27	<u>0</u> 28	RIGHT A-PILLAR (UPPER OR LOWER)	<u>1</u> 51		PARKING BRAKE RELEASE
ROOF SIDE RAIL	<u>0</u> 29	<u>0</u> 30	CENTER CONSOLE	<u>0</u> 52		PARKING BRAKE PEDAL
B-PILLAR	<u>0</u> 31	<u>0</u> 32	TRANSMISSION SELECTOR LEVER	<u>0</u> 53		A/C OR UPPER VENT OUTLETS
C-PILLAR	<u>0</u> 33	<u>0</u> 34	RIM, HORN, SPOKE	<u>0</u> 54		HEATER OR A/C DUCTS
D-PILLAR	<u>8</u> 35	<u>8</u> 36				RADIO
HEADLINING	<u>0</u> 37	<u>0</u> 38				OTHER: * _____
ROOF STRUCTURE	<u>0</u> 39	<u>0</u> 40				_____
T-ROOF/SUN ROOF	<u>8</u> 41	<u>8</u> 42				
OTHER: * _____	<u>8</u> 43	<u>8</u> 44				
						REAR
						WINDOW
						WINDOW HEADER
						CONSOLES
						VERTICAL
						ROOF

* MORE THAN ONE ITEM MAY BE NOTED.

Duplicate columns 1-8
from the previous card.

Module S T Format 0 2
9 10 11 12

SEATS

ST-1


FRONT SEAT		DRIVER	PASSENGER	FRONT SEAT-BACK		DRIVER	PASSENGER
TYPE OF FRONT SEAT (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (97) OTHER: _____ (99) UNKNOWN		<u>03</u> 13 14	<u>03</u> 15 16	SEAT-BACK TYPE (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 30	<u>1</u> 31
TYPE OF SEAT MOUNT (1) STANDARD (2) PEDESTAL (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 17	<u>1</u> 18	SEAT-BACK LOCK TYPE (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 32	<u>1</u> 33
SWIVEL MECHANISM EQUIPPED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 19	<u>0</u> 20	LOCKS HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 34	<u>1</u> 35
ORIGINAL EQUIPMENT SEATS (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 21	<u>1</u> 22	RECLINER MECHANISM HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 36	<u>1</u> 37
CONTACT OF SEAT BY REAR OCCUPANT (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 23	<u>✓</u> 24	HEAD RESTRAINT HEAD RESTRAINT TYPE (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>2</u> 38	<u>2</u> 39
FRONT SEAT DAMAGE (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 25	<u>0</u> 26	REMOVED PRE-CRASH (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 40	<u>8</u> 41
CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED		<u>0</u> 27		ADJUSTMENT AT CRASH (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 42	<u>8</u> 43
FRONT SEAT ROTATION (0) NONE APPARENT (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 28	<u>0</u> 29	HEAD RESTRAINT DAMAGE (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 44	<u>0</u> 45

SEATS ST-2					
FRONT SEAT ADJUSTMENT SEAT ADJUSTMENT TYPE (0) NONE (<i>RIGID</i>) (1) MANUAL (2) POWER (7) OTHER: _____ (8) NOT APPLICABLE (<i>NO SEAT</i>) (9) UNKNOWN ADJUSTMENT PROVIDED (1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN SEAT ADJUSTER DAMAGE (0) NONE (1) CHUCKING (<i>FREE PLAY</i>) (2) DEFORMED (<i>RELEASED/JAMMED</i>) (3) SEPARATED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN SEAT ADJUSTER SEPARATION (0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN PRE-CRASH POSITION (1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN	DRIVER <u>1</u> 46 <u>1</u> 48 <u>0</u> 50 <u>8</u> 52 <u>3</u> 54	PASSENGER <u>1</u> 47 <u>1</u> 49 <u>0</u> 51 <u>8</u> 53 <u>3</u> 55	SECOND SEAT (CONT.) CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (<i>NO CENTER ARMREST</i>) (9) UNKNOWN IF EQUIPPED SECOND SEAT-BACK LOCKS <i>FOR THE FOLLOWING, USE:</i> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN LEFT OR CENTER, EQUIPPED LEFT OR CENTER, HELD (3) SEAT FOLDED DOWN RIGHT, EQUIPPED RIGHT, HELD (3) SEAT FOLDED DOWN	<u>8</u> 60 <div style="display: flex; justify-content: space-between;"> LEFT RIGHT </div> <u>1</u> 61 <u>0</u> 63 <u>0</u> 65 <u>8</u> 67 <u>0</u> 62 <u>8</u> 64 <u>1</u> 66 <u>1</u> 68	
SECOND SEAT TYPE OF SECOND SEAT (0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN SECOND SEAT DAMAGE (0) NONE (1) BACKREST ONLY (<i>DAMAGED OR LOOSENED</i>) (2) CUSHION ONLY (<i>DAMAGED OR LOOSENED</i>) (3) BACKREST & CUSHION (<i>DAMAGED OR LOOSENED</i>) (4) INTEGRAL CHILD SEAT (<i>PRIORITY CODE</i>) (5) LUGGAGE AREA ACCESS PANEL (<i>DAMAGED OR LOOSENED</i>) (8) NOT APPLICABLE (9) UNKNOWN	LEFT <u>2</u> 56 <u>3</u> 58	RIGHT <u>2</u> 57 <u>0</u> 59	THIRD SEAT EQUIPPED BACKREST DAMAGED CUSHION DAMAGED VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS (0) NOT EQUIPPED (<i>OR REMOVED</i>) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (<i>NO REAR SEAT</i>) (9) UNKNOWN <i>Applies to any rear-seat position</i>	<u>0</u> 69 <u>8</u> 71 <u>8</u> 73 <u>0</u> 70 <u>8</u> 72 <u>0</u> 74 <u>1</u> 75	


<p>DRIVER SIDE</p> <p>LOCATION OF AIRBAG STEERING WHEEL</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 13</p> <p><u>1</u> 14</p>	<p>PASSENGER SIDE</p> <p>LOCATION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX)</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 16</p> <p><u>0</u> 17</p>
<p>CONDITION OF AIRBAG STEERING WHEEL</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 15</p>	<p>CONDITION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX)</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>8</u> 18</p>
<p>DRIVER SIDE</p> <p>AIRBAG STEERING WHEEL</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 19</p> <p><u>0</u> 20</p>	<p>PASSENGER SIDE</p> <p>AIRBAG INSTRUMENT PANEL (GLOVE BOX)</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>8</u> 21</p> <p><u>8</u> 22</p>

AIRBAG NUMBER ON DRIVER SIDE:

Driver Airbag

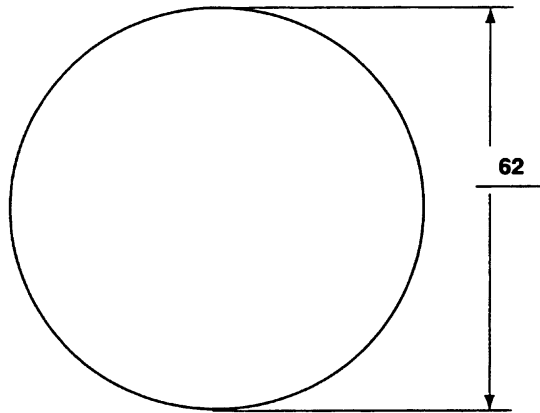

Driver Airbag Doors

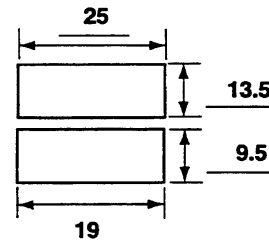


Vents: ☒ Y ☐ N
if yes, how many: 2
11 and 1 O'clock

Tethers: ☒ Y ☐ N
if yes, how many: 2


AIRBAG NUMBER ON PASSENGER SIDE:

Passenger Airbag

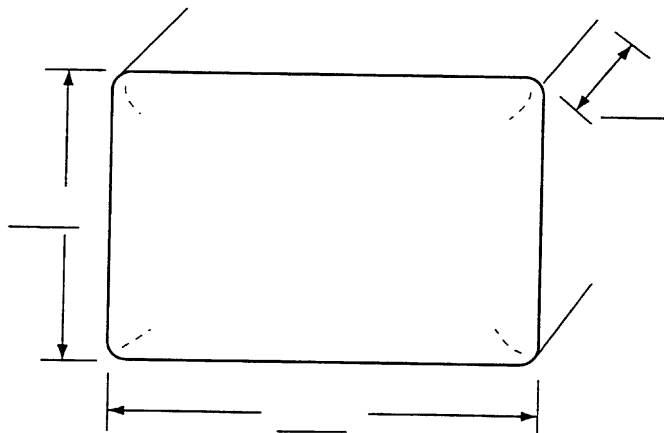

Passenger Airbag Door

Single Door

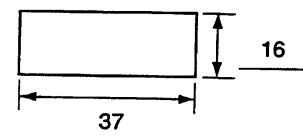

Airbag turned off

Vents: ☐ Y ☐ N
if yes, how many: _____

Tethers: ☐ Y ☐ N
if yes, how many: _____

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,
ARE TO BE FILLED IN
FOR EACH CASE VEHICLE OCCUPANT,
WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,
USE ADDITIONAL COPIES
OF PAGES OC-1, OC-2, OC-3,
AND IC-2 TO DESCRIBE THEM
AND ATTACH THE COPIES TO THIS REPORT.

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

01
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
- (2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
- (9) UNKNOWN

1
15

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
- (2) SECOND
- (3) THIRD
- (4) FOURTH
- (7) OTHER: _____
- (8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
- (9) UNKNOWN

1
16

LATERAL LOCATION

- (1) LEFT
- (2) LEFT CENTER
- (3) CENTER
- (4) RIGHT CENTER
- (5) RIGHT
- (6) ALL (LYING ON SEAT)
- (8) EXTERNAL TO PASSENGER
COMPARTMENT
- (9) UNKNOWN

1
17

POSTURE

- (10) SITTING ON SEAT
- (11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
- (12) SITTING ON CONSOLE
- (20) ON LAP OR IN ARMS
- (30) STANDING ON SEAT
- (40) STANDING ON FLOOR
- (47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
- (50) IN BASSINET
- (60) IN CHILD SEAT
- (65) IN CHILD HARNESS
- (70) LYING ON SEAT
- (80) LYING/SITTING ON PASSENGER
FLOOR
- (83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
- (85) ON CARGO FLOOR/FOLDED
SEAT-BACK
- (87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
- (97) OTHER: _____
- (99) UNKNOWN

10
18 19

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
- (98) 98 YEARS OR OLDER
- (99) UNKNOWN

27
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
- (25) 25 MONTHS OR OLDER
- (99) UNKNOWN

25
22 23

MASS (kg)

- (999) UNKNOWN

(160 lb)

073
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(5 ft, 9 in)

175
27 28 29

SEX

- (1) MALE
- (2) FEMALE
- (9) UNKNOWN

1
30

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
- (01) FIRST AID AT SCENE
- (02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
- (03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
- (04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
- (05) FATAL, DEAD AT SCENE
- (06) FATAL, DOA
- (07) FATAL, DEAD WITHIN 24 HOURS
- (08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
- (09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
- (10) FATAL DEAD WITHIN UNKNOWN
PERIOD
- (99) UNKNOWN

02
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

05
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
- (1) YES, TIME & TYPE UNKNOWN
- (2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
- (3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
- (4) PREGNANT
- (5) POST-CRASH FATAL (DROWNING)
- (6) POST-CRASH NON-FATAL INJURY
- (7) OTHER: _____
- (8) COMBINATION OF ABOVE
(CIRCLE EACH)
- (9) UNKNOWN

0
35

OCCUPANT INFORMATION OC-2

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,
SEVERITY UNKNOWN
- (9) UNKNOWN

2
36

CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

8 8
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

0
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &
PASSIVE RESTRAINT
- (7) OTHER: _____
- (9) UNKNOWN

1
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY
EQUIPPED)
- (9) UNKNOWN

2
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: _____
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

9 8
44 45

IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1
46

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN


0
47

SOURCE OF INFORMATION

- (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

0
48

INDICATE LOCATION OF INJURIES.

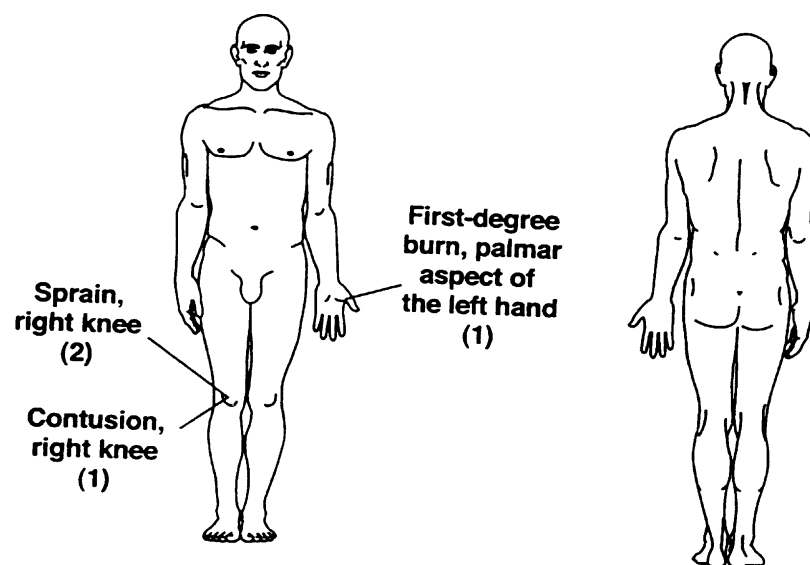

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

[illegible]

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)


PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (E.G. *FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

THE FIGURE BELOW
IS AN EXPLANATION OF THE BODY REGION CODES
LISTED ON PAGE IC - 4.

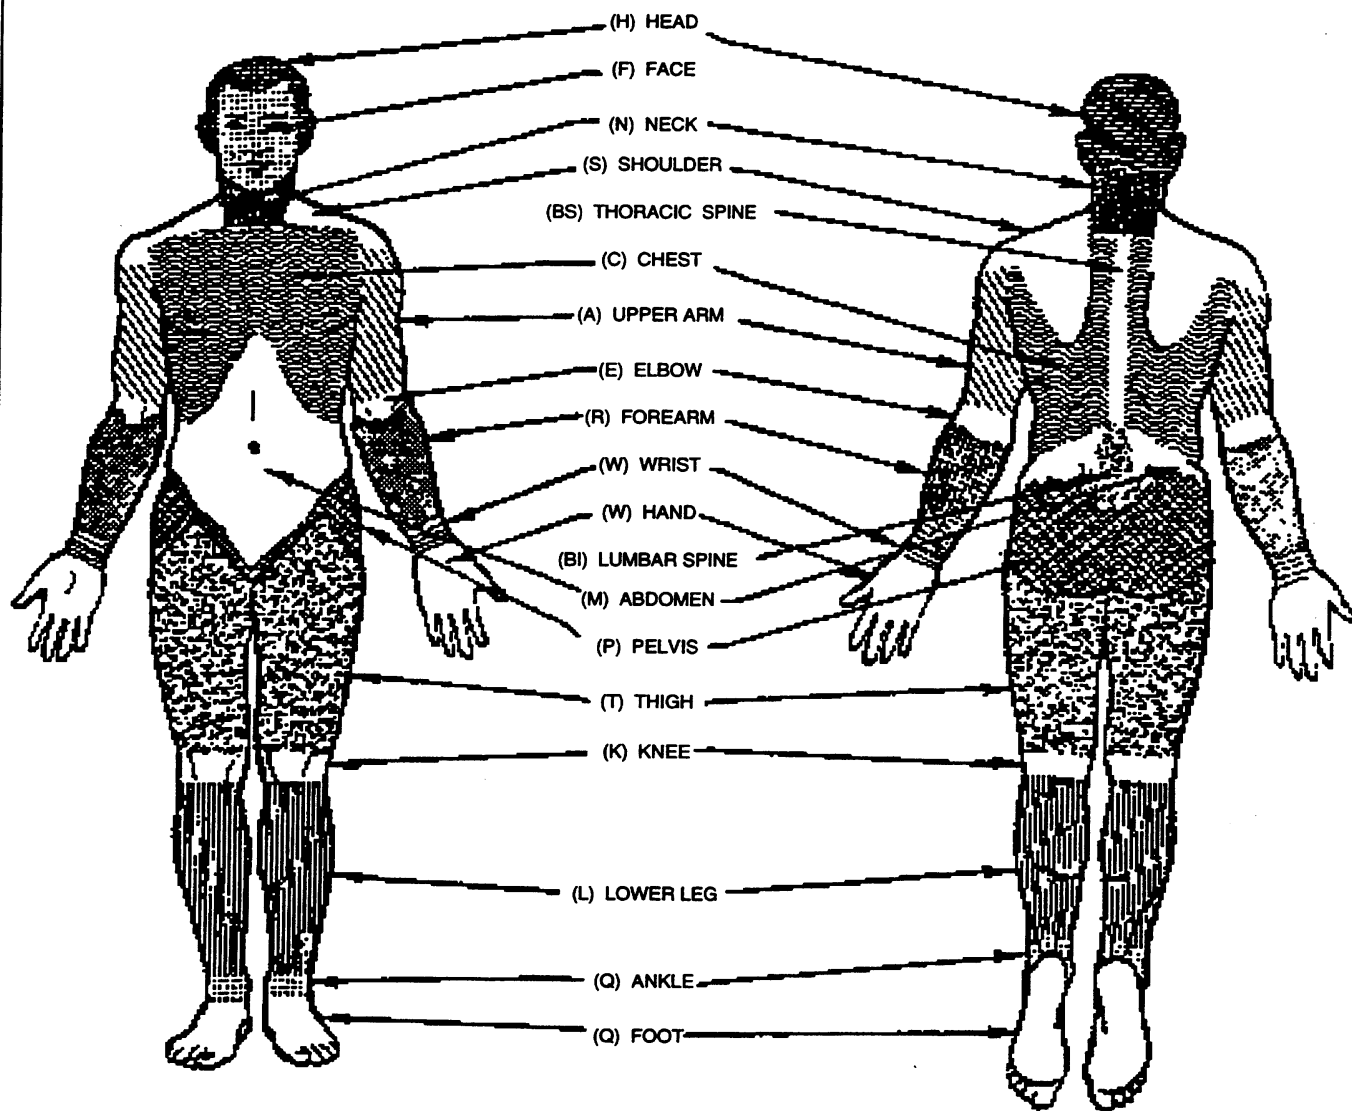

CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

1 BODY REGION

(H) HEAD/SKULL
 (F) FACE
 (N) NECK
 (S) SHOULDER
 (X) UPPER EXTREMITIES
 (A) ARM (*UPPER*)
 (E) ELBOW
 (R) FOREARM
 (W) WRIST/HAND
 (C) CHEST
 (M) ABDOMEN
 (B) BACK
 (P) PELVIC/HIP
 (Y) LOWER EXTREMITIES
 (T) THIGH
 (K) KNEE
 (L) LEG (*LOWER*)
 (Q) ANKLE/FOOT
 (O) WHOLE BODY
 (U) UNKNOWN

3 LESION

(L) LACERATION
 (C) CONTUSION
 (A) ABRASION
 (F) FRACTURE
 (P) PERFORATION,
 PUNCTURE
 (K) CONCUSSION
 (V) AVULSION
 (R) RUPTURE
 (S) SPRAIN
 (D) DISLOCATION
 (N) CRUSH
 (M) AMPUTATION
 (B) BURN
 (G) DETACHMENT,
 SEPARATION
 (Z) FRACTURE AND
 DISLOCATION
 (T) STRAIN
 (E) TOTAL SEVERANCE,
 TRANSECTION
 (O) OTHER
 (U) UNKNOWN

4 SYSTEM/ORGAN

(S) SKELETAL
 (V) VERTEBRAE
 (J) JOINTS
 (D) DIGESTIVE
 (L) LIVER
 (N) NERVOUS SYSTEM
 (B) BRAIN
 (C) SPINAL CORD
 (E) EARS
 (O) EYES
 (A) ARTERIES
 (H) HEART
 (Q) SPLEEN
 (G) UROGENITAL
 (K) KIDNEYS
 (R) RESPIRATORY
 (P) PULMONARY/LUNGS
 (M) MUSCLES
 (T) THYROID, OTHER
 ENDOCRINE GLAND
 (I) INTEGUMENTARY (*SKIN*)
 (W) ALL SYSTEMS IN REGION
 (U) UNKNOWN

2 ASPECT

(R) RIGHT
 (L) LEFT
 (B) BILATERAL
 (C) CENTRAL
 (A) ANTERIOR/FRONT
 (P) POSTERIOR/BACK
 (S) SUPERIOR/UPPER
 (I) INFERIOR/LOWER
 (W) WHOLE REGION
 (U) UNKNOWN

BODY REGION	ASPECT	LESION	SYSTEM/ORGAN	SEVERITY
1	2	3	4	5

5 SEVERITY
(OR "AIS", ABBREVIATED INJURY SCALE)

(0) NONE
 (1) MINOR
 (2) MODERATE
 (3) SERIOUS
 (4) SEVERE
 (5) CRITICAL
 (6) MAXIMUM
 (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

02
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
(2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
(9) UNKNOWN

2
15

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
(98) 98 YEARS OR OLDER
(99) UNKNOWN

21
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
(25) 25 MONTHS OR OLDER
(99) UNKNOWN

25
22 23

MASS (kg)

- (999) UNKNOWN

(170 lb)

077
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(5ft, 9in)

175
27 28 29

SEX

- (1) MALE
(2) FEMALE
(9) UNKNOWN

1
30

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
(2) SECOND
(3) THIRD
(4) FOURTH
(7) OTHER: _____
(8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
(9) UNKNOWN

1
16

LATERAL LOCATION

- (1) LEFT
(2) LEFT CENTER
(3) CENTER
(4) RIGHT CENTER
(5) RIGHT
(6) ALL (LYING ON SEAT)
(8) EXTERNAL TO PASSENGER
COMPARTMENT
(9) UNKNOWN

5
17

POSTURE

- (10) SITTING ON SEAT
(11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
(12) SITTING ON CONSOLE
(20) ON LAP OR IN ARMS
(30) STANDING ON SEAT
(40) STANDING ON FLOOR
(47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
(50) IN BASSINET
(60) IN CHILD SEAT
(65) IN CHILD HARNESS
(70) LYING ON SEAT
(80) LYING/SITTING ON PASSENGER
FLOOR
(83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
(85) ON CARGO FLOOR/FOLDED
SEAT-BACK
(87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
(97) OTHER: _____
(99) UNKNOWN

10
18 19

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
(01) FIRST AID AT SCENE
(02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
(03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
(04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
(05) FATAL, DEAD AT SCENE
(06) FATAL, DOA
(07) FATAL, DEAD WITHIN 24 HOURS
(08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
(09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
(10) FATAL DEAD WITHIN UNKNOWN
PERIOD
(99) UNKNOWN

02
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

01
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
(1) YES, TIME & TYPE UNKNOWN
(2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
(3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
(4) PREGNANT
(5) POST-CRASH FATAL (DROWNING)
(6) POST-CRASH NON-FATAL INJURY
(7) OTHER: _____
(8) COMBINATION OF ABOVE
(CIRCLE EACH)
(9) UNKNOWN

0
35

OCCUPANT INFORMATION OC-2

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,
SEVERITY UNKNOWN
- (9) UNKNOWN

2
36

CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

8 8
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

0
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &
PASSIVE RESTRAINT
- (7) OTHER: *airbag not deployed*
- (9) UNKNOWN

1
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED *- turned off at switch*
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY
EQUIPPED)
- (9) UNKNOWN

1
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: _____
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

9 8
44 45

IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1
46

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

0
47

SOURCE OF INFORMATION



- (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

0
48

INDICATE LOCATION OF INJURIES.

Contusion,
right side
of forehead
(1)

Contusion,
right knee
(1)

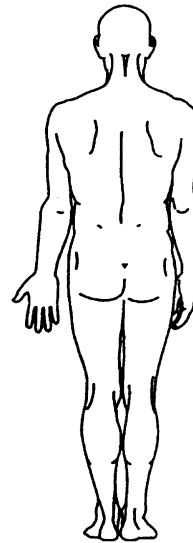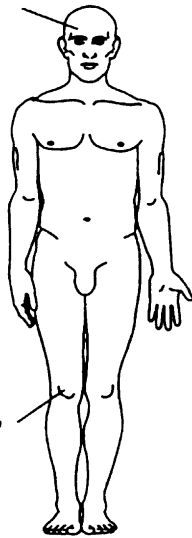

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

[illegible]

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (AIRBAG)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

Roof

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (E.G. *FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

[illegible]

Topic: Management 33, 34, 35, 36, 37, 38, 39, 40, 41, 42, 43, 44, 45, 46, 47, 48, 49, 50, 51, 52, 53, 54, 55, 56, 57, 58, 59, 60, 61, 62, 63, 64, 65, 66, 67, 68, 69, 70, 71, 72, 73, 74, 75, 76, 77, 78, 79, 80, 81, 82, 83, 84, 85, 86, 87, 88, 89, 90, 91, 92, 93, 94, 95, 96, 97, 98, 99, 100, 101, 102, 103, 104, 105, 106, 107, 108, 109, 110, 111, 112, 113, 114, 115, 116, 117, 118, 119, 120, 121, 122, 123, 124, 125, 126, 127, 128, 129, 130, 131, 132, 133, 134, 135, 136, 137, 138, 139, 140, 141, 142, 143, 144, 145, 146, 147, 148, 149, 150, 151, 152, 153, 154, 155, 156, 157, 158, 159, 160, 161, 162, 163, 164, 165, 166, 167, 168, 169, 170, 171, 172, 173, 174, 175, 176, 177, 178, 179, 180, 181, 182, 183, 184, 185, 186, 187, 188, 189, 190, 191, 192, 193, 194, 195, 196, 197, 198, 199, 200, 201, 202, 203, 204, 205, 206, 207, 208, 209, 210, 211, 212, 213, 214, 215, 216, 217, 218, 219, 220, 221, 222, 223, 224, 225, 226, 227, 228, 229, 230, 231, 232, 233, 234, 235, 236, 237, 238, 239, 240, 241, 242, 243, 244, 245, 246, 247, 248, 249, 250, 251, 252, 253, 254, 255, 256, 257, 258, 259, 260, 261, 262, 263, 264, 265, 266, 267, 268, 269, 270, 271, 272, 273, 274, 275, 276, 277, 278, 279, 280, 281, 282, 283, 284, 285, 286, 287, 288, 289, 290, 291, 292, 293, 294, 295, 296, 297, 298, 299, 300, 301, 302, 303, 304, 305, 306, 307, 308, 309, 310, 311, 312, 313, 314, 315, 316, 317, 318, 319, 320, 321, 322, 323, 324, 325, 326, 327, 328, 329, 330, 331, 332, 333, 334, 335, 336, 337, 338, 339, 340, 341, 342, 343, 344, 345, 346, 347, 348, 349, 350, 351, 352, 353, 354, 355, 356, 357, 358, 359, 360, 361, 362, 363, 364, 365, 366, 367, 368, 369, 370, 371, 372, 373, 374, 375, 376, 377, 378, 379, 380, 381, 382, 383, 384, 385, 386, 387, 388, 389, 390, 391, 392, 393, 394, 395, 396, 397, 398, 399, 400, 401, 402, 403, 404, 405, 406, 407, 408, 409, 410, 411, 412, 413, 414, 415, 416, 417, 418, 419, 420, 421, 422, 423, 424, 425, 426, 427, 428, 429, 430, 431, 432, 433, 434, 435, 436, 437, 438, 439, 440, 441, 442, 443, 444, 445, 446, 447, 448, 449, 450, 451, 452, 453, 454, 455, 456, 457, 458, 459, 460, 461, 462, 463, 464, 465, 466, 467, 468, 469, 470, 471, 472, 473, 474, 475, 476, 477, 478, 479, 480, 481, 482, 483, 484, 485, 486, 487, 488, 489, 490, 491, 492, 493, 494, 495, 496, 497, 498, 499, 500, 501, 502, 503, 504, 505, 506, 507, 508, 509, 510, 511, 512, 513, 514, 515, 516, 517, 518, 519, 520, 521, 522, 523, 524, 525, 526, 527, 528, 529, 530, 531, 532, 533, 534, 535, 536, 537, 538, 539, 540, 541, 542, 543, 544, 545, 546, 547, 548, 549, 550, 551, 552, 553, 554, 555, 556, 557, 558, 559, 560, 561, 562, 563, 564, 565, 566, 567, 568, 569, 570, 571, 572, 573, 574, 575, 576, 577, 578, 579, 580, 581, 582, 583, 584, 585, 586, 587, 588, 589, 590, 591, 592, 593, 594, 595, 596, 597, 598, 599, 600, 601, 602, 603, 604, 605, 606, 607, 608, 609, 610, 611, 612, 613, 614, 615, 616, 617, 618, 619, 620, 621, 622, 623, 624, 625, 626, 627, 628, 629, 630, 631, 632, 633, 634, 635, 636, 637, 638, 639, 640, 641, 642, 643, 644, 645, 646, 647, 648, 649, 650, 651, 652, 653, 654, 655, 656, 657, 658, 659, 660, 661, 662, 663, 664, 665, 666, 667, 668, 669, 670, 671, 672, 673, 674, 675, 676, 677, 678, 679, 680, 681, 682, 683, 684, 685, 686, 687, 688, 689, 690, 691, 692, 693, 694, 695, 696, 697, 698, 699, 700, 701, 702, 703, 704, 705, 706, 707, 708, 709, 710, 711, 712, 713, 714, 715, 716, 717, 718, 719, 720, 721, 722, 723, 724, 725, 726, 727, 728, 729, 730, 731, 732, 733, 734, 735, 736, 737, 738, 739, 740, 741, 742, 743, 744, 745, 746, 747, 748, 749, 750, 751, 752, 753, 754, 755, 756, 757, 758, 759, 760, 761, 762, 763, 764, 765, 766, 767, 768, 769, 770, 771, 772, 773, 774, 775, 776, 777, 778, 779, 780, 781, 782, 783, 784, 785, 786, 787, 788, 789, 790, 791, 792, 793, 794, 795, 796, 797, 798, 799, 800, 801, 802, 803, 804, 805, 806, 807, 808, 809, 810, 811, 812, 813, 814, 815, 816, 817, 818, 819, 820, 821, 822, 823, 824, 825, 826, 827, 828, 829, 830, 831, 832, 833, 834, 835, 836, 837, 838, 839, 840, 841, 842, 843, 844, 845, 846, 847, 848, 849, 850, 851, 852, 853, 854, 855, 856, 857, 858, 859, 860, 861, 862, 863

Figure 11-10-10

Year	Number of cases
1990	10
1991	15
1992	20
1993	25
1994	30
1995	35
1996	40
1997	45
1998	50
1999	55
2000	60
2001	65
2002	70
2003	75
2004	80
2005	85
2006	90
2007	95
2008	100
2009	105
2010	110
2011	115
2012	120
2013	125
2014	130
2015	135
2016	140
2017	145
2018	150
2019	155
2020	160
2021	165
2022	170
2023	175
2024	180
2025	185
2026	190
2027	195
2028	200
2029	205
2030	210

1. *Journal of the American Medical Association*, 2000; 283: 2686-2692.

[illegible]



PN 22300 N1



PN 22300 #2




PN 22300 #3



PN 22300 #4



PN 22300 # 5
Best Available

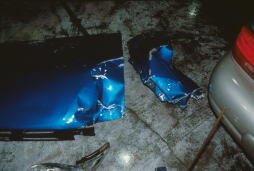


PN 22300 #6



PN 22300 #7
Best Available



PN 22300 # 8
Best Available

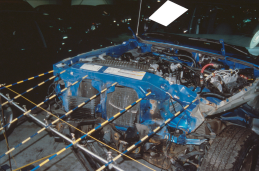

PN 22300 #9
Best Available



PN 22300 #10



PN 22300 #11
Best Available



PN 22300 #12



PN 22300 #13
Best Available



PN 22300 #14



PN 22300 #15



PN 22300 #16



PN 22300 #17



PN 22300 #18
Best Available



PN 22300 #19
Best Available



PN 22300 #20
Best Available



PN 22300 #21
Best Available



PN 22300 #22
Best Available



PN 22300 #23
Best Available




PN 22300 #24
Best Available



PN 22300 #25
Best Available



PN 22300 #26
Best Available

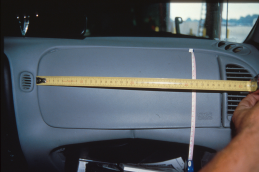

PN 22300 #27
Best Available



PN 22300 #28



PN 22300 #29




PN 22300 #30



PN 22300 #31



PN 22300 #32

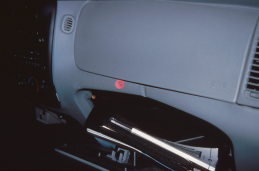

PN 22300 #33



PN 22300 #34



PN 22300 #35



PN 22300 #36



PN 22300 #37



PN 22300 #38



PN 22300 #39



PN 22300 #40



PN 22300 #41



PN 22300 #42



PN 22300 #43



PN 22300 #44



PN 22300 #45



PN 22300 #46



PN 22300 #47



PN 22300 #48



PN 22300 #49



PN 22300 #50



PN 22300 #51



PN 22300 #52



PN 22300 #53



PN 22300 #54

CASE NO.: 200-88

CASE VEHICLE: 1988 Ford


TYPE: Ranger XL, 4 x 4, Super Cab pickup

OCCUPANT: Driver, 27-year-old male

STATURE: 186 cm (5 ft, 9 in.) MASS: 75 kg (165 lbs)

RESTRAINTS: 3-point belt not worn; frontal-impact airbag deployed

SEVERITY: MAIS - 3 I - 020 - 5



CASE NO: 2024-06

CRIME VEHICLE: 1999 Ford

TYPE: Ranger GL, 4 x 4, 2-door, pickup

OCCUPANT: Right front: 25-year-old male

STATURE: 175 cm (5 ft 9 in) MASS: 77 kg (170 lbs)

RESTRAINTS: 3-point belt not worn; frontal impact airbag did not deploy (turned off at vehicle)

SEVERITY: MAJOR - 1 MINOR - 0

Contusion,
right side
of forehead
(1)



Contusion,
right knee
(1)

